



## MATERIALS

Head and cover: Aluminium alloy

Bowl: Polyammide

Bypass valve: Polyammide

Seals: NBR Nitrile FKM Fluoroelastomer on request

Indicator housing: Brass

### PRESSURE (ISO 10771-1:2002)

Max working: 300 kPa (3 bar)

Test: 500 kPa (5 bar)

Bursting: 1 MPa (10 bar)

Collapse, differential for the filter element (ISO 2941): 300 kPa (3 bar)

## **BYPASS VALVE**

Setting: 170 kPa (1,7 bar) ± 10%

WORKING TEMPERATURE


From -25° to + 110° C

# COMPATIBILITY (ISO 2943:1999)

Full with fluids: HH-HL-HM-HV-HTG (according to ISO 6743/4) For fluids different than the above mentioned, please contact our Sales Department.






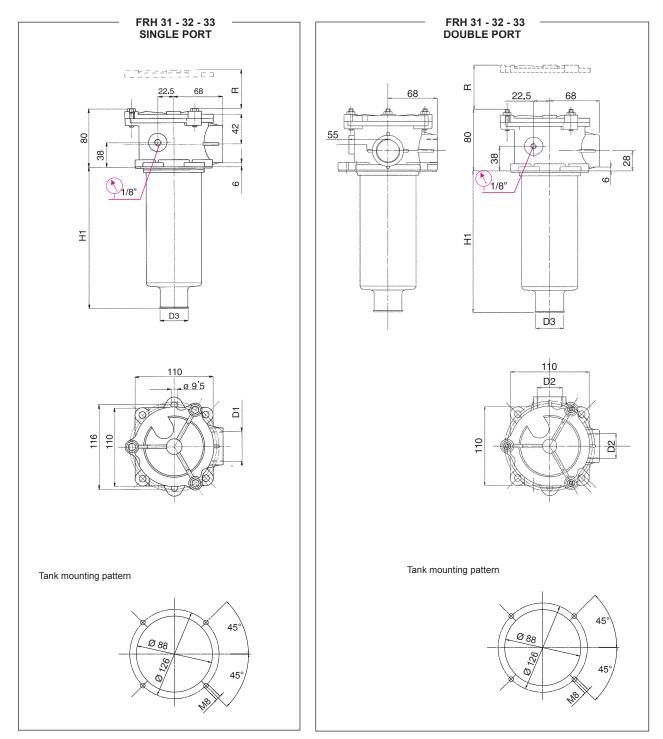


FILTER	FILTER HOUSING						
	D1	D2	D3	H1	R	kg	
FRH31	3/4" - 1" - 1" 1/4	1"	27	106	165	0,95	
FRH32	3/4" - 1" - 1" 1/4	1"	27	152	205	1,10	
FRH33	3/4" - 1" - 1" 1/4	1"	40	235	285	1,25	

		ТҮРЕ					
		F = FILTER COMPLETE	F	F	F		
		B = FILTER HOUSING	В	В	В	ELEMENT E	
R H		FAMILY,	_		. –	FAMILY R A	
		NOMINAL SIZE & LENGTH	31	32	33	SIZE & LENGTH	
		PORT TYPE			1		
		B = BSP thread	В	В	В		
		A = BSP thread (double port A08 only)	Α	Α	А	_	
		N = NPT thread	N	N	N		
		S = SAE thread	S	S	S		
	Τ	PORT SIZE		1	1		
		06 = 3/4"	06	06	06		
		08 = 1"	08	08	08	_	
		10 = 1"1/4	10	10	10		
	в	BYPASS VALVE					
		B = 170 kPa (1,7 bar)	В	В	В		
		SEALS		-	-	SEALS	
		N = NBR Nitrile	N	N	N	N = NBR	
		F = FKM Fluoroelastomer	F	F	F	F = FKM	
		FILTER MEDIA				FILTER MEDIA	
		FA = fiber $5 \mu m_{(c)} \beta > 1.000$	FA	FA	FA	$FA = fiber  5\mu m_{\rm (c)}$	
C		FA = fiber 5μm <sub>(c)</sub> β>1.000 FB = fiber 7μm <sub>(c)</sub> β>1.000	FB	FB	FB	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$	
		FA = fiber   5 μm <sub>(c)</sub> β>1.000     FB = fiber   7 μm <sub>(c)</sub> β>1.000     FC = fiber   12 μm <sub>(c)</sub> β>1.000	FB FC	FB FC	FB FC	FA = fiber $5\mu m_{(c)}$ FB = fiber $7\mu m_{(c)}$ FC = fiber $12\mu m_{(c)}$	
C		FA = fiber   5 μm <sub>(c)</sub> β>1.000     FB = fiber   7 μm <sub>(c)</sub> β>1.000     FC = fiber   12 μm <sub>(c)</sub> β>1.000     FD = fiber   21 μm <sub>(c)</sub> β>1.000	FB FC FD	FB FC FD	FB FC FD	FA = fiber $5\mu m_{(c)}$ FB = fiber $7\mu m_{(c)}$ FC = fiber $12\mu m_{(c)}$ FD = fiber $21\mu m_{(c)}$	
C		FA = fiber $5 \mu m_{(c)} \beta > 1.000$ FB = fiber $7 \mu m_{(c)} \beta > 1.000$ FC = fiber $12 \mu m_{(c)} \beta > 1.000$ FD = fiber $21 \mu m_{(c)} \beta > 1.000$ CC = cellulose $10 \mu m \beta > 2$	FB FC FD CC	FB FC FD CC	FB FC FD CC	FA = fiber $5\mu m_{(c)}$ FB = fiber $7\mu m_{(c)}$ FC = fiber $12\mu m_{(c)}$ FD = fiber $21\mu m_{(c)}$ CC = cellulose $10\mu m$	
C		FA = fiber $5 \mu m_{(c)} \beta > 1.000$ FB = fiber $7 \mu m_{(c)} \beta > 1.000$ FC = fiber $12 \mu m_{(c)} \beta > 1.000$ FD = fiber $21 \mu m_{(c)} \beta > 1.000$ CC = cellulose $10 \mu m \beta > 2$ CD = cellulose $25 \mu m \beta > 2$	FB FC FD CC CD	FB FC FD CC CD	FB FC FD CC CD	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$	
		FA = fiber $5 \mu m_{(c)} \beta > 1.000$ FB = fiber $7 \mu m_{(c)} \beta > 1.000$ FC = fiber $12 \mu m_{(c)} \beta > 1.000$ FD = fiber $21 \mu m_{(c)} \beta > 1.000$ CC = cellulose $10 \mu m \beta > 2$	FB FC FD CC	FB FC FD CC	FB FC FD CC	FA = fiber $5\mu m_{(c)}$ FB = fiber $7\mu m_{(c)}$ FC = fiber $12\mu m_{(c)}$ FD = fiber $21\mu m_{(c)}$ CC = cellulose $10\mu m$	
		FA = fiber $5 \mu m_{(c)} \beta > 1.000$ FB = fiber $7 \mu m_{(c)} \beta > 1.000$ FC = fiber $12 \mu m_{(c)} \beta > 1.000$ FD = fiber $21 \mu m_{(c)} \beta > 1.000$ CC = cellulose $10 \mu m \beta > 2$ CD = cellulose $25 \mu m \beta > 2$ ME = wire mesh $60 \mu m$	FB FC FD CC CD	FB FC FD CC CD	FB FC FD CC CD	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$	
		FA = fiber $5 \mu m_{(c)} \beta > 1.000$ FB = fiber $7 \mu m_{(c)} \beta > 1.000$ FC = fiber $12 \mu m_{(c)} \beta > 1.000$ FD = fiber $21 \mu m_{(c)} \beta > 1.000$ CC = cellulose $10 \mu m \beta > 2$ CD = cellulose $25 \mu m \beta > 2$ ME = wire mesh $60 \mu m$ CLOGGING INDICATOR	FB FC FD CC CD ME	FB FC FD CC CD ME	FB FC FD CC CD ME	FA = fiber $5\mu m_{(c)}$ FB = fiber $7\mu m_{(c)}$ FC = fiber $12\mu m_{(c)}$ FD = fiber $21\mu m_{(c)}$ CC = cellulose $10\mu m$ CD = cellulose $25\mu m$ ME = wire mesh $60\mu m$	
		FA = fiber 5 μm <sub>(c)</sub> β>1.000   FB = fiber 7 μm <sub>(c)</sub> β>1.000   FC = fiber 12 μm <sub>(c)</sub> β>1.000   FD = fiber 21 μm <sub>(c)</sub> β>1.000   CC = cellulose 10 μm β>2   CD = cellulose 25μm β>2   ME = wire mesh 60μm   CLOGGING INDICATOR   05 = nr. 2 x 1/8" ports, plugged	FB FC FD CC CD ME 05	FB FC FD CC CD	FB FC FD CC CD	FA = fiber $5\mu m_{(c)}$ FB = fiber $7\mu m_{(c)}$ FC = fiber $12\mu m_{(c)}$ FD = fiber $21\mu m_{(c)}$ CC = cellulose $10\mu m$ CD = cellulose $25\mu m$ ME = wire mesh $60\mu m$ When the filter is ordered with FKM seals, the first digit	
		FA = fiber $5\mu m_{(c)} \beta > 1.000$ FB = fiber $7\mu m_{(c)} \beta > 1.000$ FC = fiber $12\mu m_{(c)} \beta > 1.000$ FD = fiber $21\mu m_{(c)} \beta > 1.000$ CC = cellulose $10\mu m \beta > 2$ CD = cellulose $25\mu m \beta > 2$ ME = wire mesh $60\mu m$ CLOGGING INDICATOR05 = nr. 2 x 1/8" ports, plugged30 = pressure gauge, rear connection	FB FC FD CC CD ME 05 30	FB FC FD CC CD ME 05 30	FB FC FD CC CD ME 05 30	FA = fiber $5\mu m_{(c)}$ FB = fiber $7\mu m_{(c)}$ FC = fiber $12\mu m_{(c)}$ FD = fiber $21\mu m_{(c)}$ CC = cellulose $10\mu m$ CD = cellulose $25\mu m$ ME = wire mesh $60\mu m$	
		FA = fiber 5 μm <sub>(c)</sub> β>1.000   FB = fiber 7 μm <sub>(c)</sub> β>1.000   FC = fiber 12 μm <sub>(c)</sub> β>1.000   FD = fiber 21 μm <sub>(c)</sub> β>1.000   CC = cellulose 10 μm β>2   CD = cellulose 25μm β>2   ME = wire mesh 60μm   CLOGGING INDICATOR   05 = nr. 2 x 1/8" ports, plugged	FB FC FD CC CD ME 05	FB FC FD CC CD ME 05	FB FC FD CC CD ME 05	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$ ME = wire mesh $60 \mu m$ When the filter is ordered with FKM seals, the first digit of the indicator code is a letter	
		FA = fiber $5\mu m_{(c)} \beta > 1.000$ FB = fiber $7\mu m_{(c)} \beta > 1.000$ FC = fiber $12\mu m_{(c)} \beta > 1.000$ FD = fiber $21\mu m_{(c)} \beta > 1.000$ CC = cellulose $10\mu m \beta > 2$ CD = cellulose $25\mu m \beta > 2$ ME = wire mesh $60\mu m$ CLOGGING INDICATOR05 = nr. 2 x 1/8" ports, plugged30 = pressure gauge, rear connection	FB FC FD CC CD ME 05 30	FB FC FD CC CD ME 05 30	FB FC FD CC CD ME 05 30	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$ ME = wire mesh $60 \mu m$ When the filter is ordered with FKM seals, the first digit of the indicator code is a letter	
		FA = fiber $5\mu m_{(c)} \beta > 1.000$ FB = fiber $7\mu m_{(c)} \beta > 1.000$ FC = fiber $12\mu m_{(c)} \beta > 1.000$ FD = fiber $21\mu m_{(c)} \beta > 1.000$ CC = cellulose $10\mu m \beta > 2$ CD = cellulose $25\mu m \beta > 2$ ME = wire mesh $60\mu m$ CLOGGING INDICATOR05 = nr. 2 x 1/8" ports, plugged30 = pressure gauge, rear connectionP1 = SPDT, pressure switchACCESSORIESW = without	FB FC FD CC CD ME 05 30	FB FC FD CC CD ME 05 30	FB FC FD CC CD ME 05 30	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$ ME = wire mesh $60 \mu m$ When the filter is ordered with FKM seals, the first digit of the indicator code is a letter	
		FA = fiber $5\mu m_{(c)}\beta > 1.000$ FB = fiber $7\mu m_{(c)}\beta > 1.000$ FC = fiber $12\mu m_{(c)}\beta > 1.000$ FD = fiber $21\mu m_{(c)}\beta > 1.000$ CC = cellulose $10\mu m\beta > 2$ CD = cellulose $25\mu m\beta > 2$ ME = wire mesh $60\mu m$ CLOGGING INDICATOR05 = nr. 2 x 1/8" ports, plugged30 = pressure gauge, rear connectionP1 = SPDT, pressure switchACCESSORIES	FB FC FD CC CD ME 05 30 P1	FB FC FD CC CD ME 05 30 P1	FB FC FD CC CD ME 05 30 P1	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$ ME = wire mesh $60 \mu m$ When the filter is ordered with FKM seals, the first digit of the indicator code is a letter	
		FA = fiber $5\mu m_{(c)} \beta > 1.000$ FB = fiber $7\mu m_{(c)} \beta > 1.000$ FC = fiber $12\mu m_{(c)} \beta > 1.000$ FD = fiber $21\mu m_{(c)} \beta > 1.000$ CC = cellulose $10\mu m \beta > 2$ CD = cellulose $25\mu m \beta > 2$ ME = wire mesh $60\mu m$ CLOGGING INDICATOR05 = nr. 2 x 1/8" ports, plugged30 = pressure gauge, rear connectionP1 = SPDT, pressure switchACCESSORIESW = withoutP = with filling plug	FB FC FD CC CD ME 05 30 P1 W	FB FC FD CC CD ME 05 30 P1 W	FB FC FD CC CD ME 05 30 P1 W	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$ ME = wire mesh $60 \mu m$ When the filter is ordered with FKM seals, the first digit of the indicator code is a letter	
		FA = fiber $5\mu m_{(c)} \beta > 1.000$ FB = fiber $7\mu m_{(c)} \beta > 1.000$ FC = fiber $12\mu m_{(c)} \beta > 1.000$ FD = fiber $21\mu m_{(c)} \beta > 1.000$ CC = cellulose $10\mu m \beta > 2$ CD = cellulose $25\mu m \beta > 2$ ME = wire mesh $60\mu m$ CLOGGING INDICATOR05 = nr. 2 x 1/8" ports, plugged30 = pressure gauge, rear connectionP1 = SPDT, pressure switchACCESSORIESW = without	FB FC FD CC CD ME 05 30 P1 W	FB FC FD CC CD ME 05 30 P1 W	FB FC FD CC CD ME 05 30 P1 W	FA = fiber $5 \mu m_{(c)}$ FB = fiber $7 \mu m_{(c)}$ FC = fiber $12 \mu m_{(c)}$ FD = fiber $21 \mu m_{(c)}$ CC = cellulose $10 \mu m$ CD = cellulose $25 \mu m$ ME = wire mesh $60 \mu m$ When the filter is ordered with FKM seals, the first digit of the indicator code is a letter	

FILTER ELEMENT							
	Α	В	С	kg	Area Media F+	(cm²) Media C+	
ERA31	70	28	85	0,20	620	990	
ERA32	70	28	130	0,25	1.000	1.600	
ERA33	70	40	210	0,40	1.660	2.670	

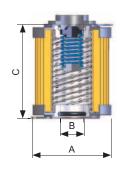



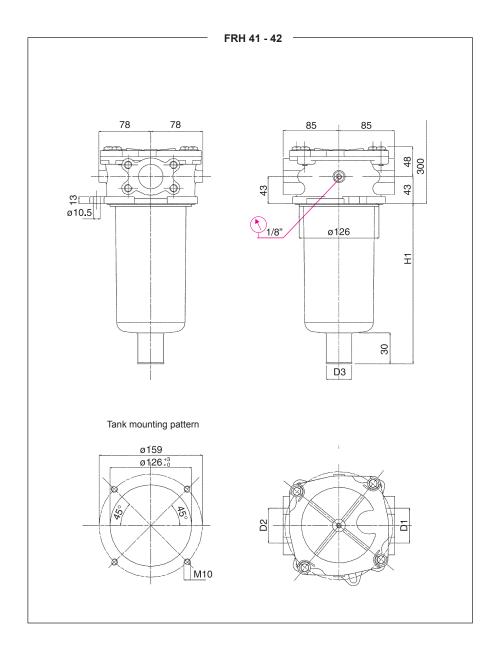

FILTER	FILTER HOUSING						
	D1	D2	D3	H1	R	kg	
FRH41	1" 1/2	1 1/2"	40	248	289	2,40	
FRH42	1" 1/2	1 1/2"	40	265	306	2,60	


	ТҮРЕ			
	F = FILTER COMPLETE	F	F	
	B = FILTER HOUSING	В	В	ELEMENT E
H	FAMILY,			FAMILY R A
	NOMINAL SIZE & LENGTH	41	42	SIZE & LENGTH
	P PORT TYPE			
	P = SAE flange 3000 psi, double port	Р	Р	
1	2 PORT SIZE			
_	12 = 1 1/2"	12	12	
- [	B BYPASS VALVE			
	B = 170 kPa (1,7 bar)	В	В	
[	SEALS			SEALS
	N = NBR Nitrile	N	N	N = NBR
	F = FKM Fluoroelastomer	F	F	F = FKM
_		_		
	FILTER MEDIA	_		FILTER MEDIA
	$FA = fiber  5\mu m_{(c)}\beta > 1.000$	FA	FA	<b>FA</b> = fiber $5\mu m_{(c)}$
	$FB = fiber 7 \mu m_{(c)} \beta > 1.000$	FB	FB	$FB = fiber 7 \mu m_{(c)}$
	FC = fiber $12 \mu m_{(c)} \beta > 1.000$	FC	FC	FC = fiber $12 \mu m_{(c)}$
	FD = fiber 21 μm <sub>(c)</sub> β >1.000	FD	FD	$FD = fiber \ 21 \ \mu m_{(c)}$
	CC = cellulose 10 $\mu$ m $\beta$ >2	СС	СС	$CC = cellulose 10 \mu m$
	CD = cellulose $25\mu$ m $\beta$ >2	CD	CD	$CD = cellulose 25 \mu m$
	ME = wire mesh $60\mu$ m	ME	ME	ME = wire mesh $60\mu$ m
	CLOGGING INDICATOR			
	05 = nr. 2 x 1/8"ports, plugged	05	05	When the filter is ordered
	30 = pressure gauge, rear connection	30	30	with FKM seals, the first digit of the indicator code is a letter
	P1 = SPDT, pressure switch	91		(please see page 184 - 185).
	FT = SFDT, pressure switch	FI	PI PI	
r	ACCESSORIES			
- <b>F</b>	W = without	W	W	
	P = with filling plug	Р	P	—
			1 .	
	X ACCESSORIES			
	X = no other accessory available	X	X	

FILTER	FILTER ELEMENT								
	Α	в	С	kg	Area (cm²)		Area (cm <sup>2</sup> )		
	~	D	<u> </u>	ĸy	Media F+	Media C+			
ERA41	99	40	211	0,75	3.800	4.280			
ERA42	99	40	250	0,90	4.550	5.100			




#### FLUID SPEED

when selecting the filter size, we suggest to consider also the max recommended fluid speed (in return lines normally 1,5 < v < 4 m/s)

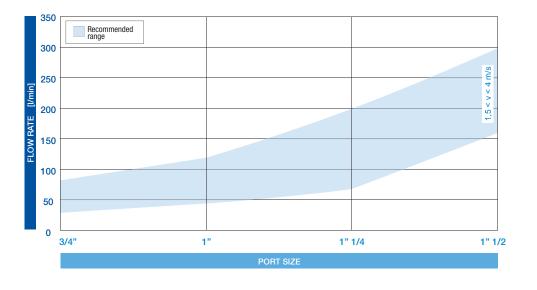

#### PRESSURE DROP CURVES (Δp)

The "Assembly Pressure Drop ( $\Delta p$ )" is obtained by adding the pressure drop values of the Filter Housing and of the Clean Filter Element corresponding to the considered Flow Rate and it must be lower than 50 kPa (0,5 bar).

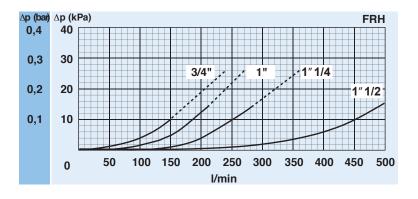


#### FILTER HOUSING PRESSURE DROP (mainly depending on the port size)



**RETURN FILTER** 


The "Assembly Pressure Drop ( $\Delta p$ )" is obtained by adding the pressure drop values of the Filter Housing and of the Clean Filter Element corresponding to the considered Flow Rate and it must be lower than 50 kPa (0,5 bar).

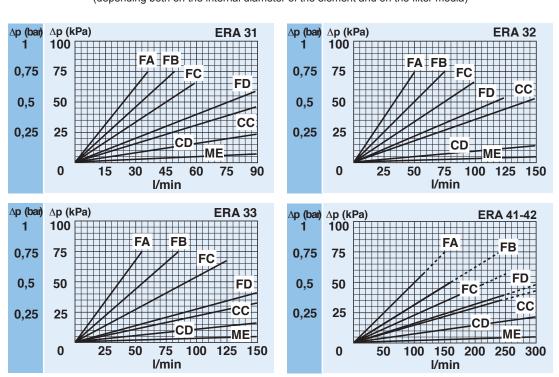

CLEAN FILTER ELEMENT PRESSURE DROP WITH F+, C+ AND ME MEDIA (depending both on the internal diameter of the element and on the filter media)

#### BYPASS VALVE PRESSURE DROP

When selecting the filter size, these curves must be taken into account if it is foreseen that any flow peak is to be absorbed by the bypass valve, it also must be of proper configuration to avoid pressure peaks. The valve pressure drop is directly proportional to fluid specific gravity.

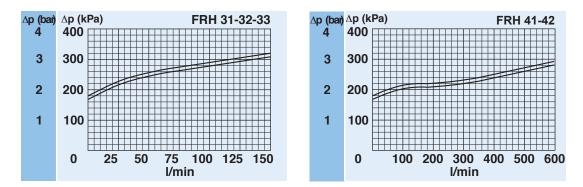

N.B. All the curves have been obtained with mineral oil having a kinematic viscosity 30 cSt and specific gravity 0,9 kg/dm<sup>3</sup>; for fluids with different features, please consider the factors described in the first part of this catalogue. All the curves are obtained from test done at the UFI HYDRAULIC DIVISION Laboratory, according to the specification ISO 3968. In case of discrepancy, please check the contamination level, viscosity and features of the fluid in use.



### CLOGGING INDICATOR

A visual or electrical indicator is available as an option and allows monitoring of the element condition. The port for the indicator is a standard feature.

### FILLING PLUG

The filling plug option gives the possibility of easily and efficiently filtering the oil from the drum.

### EASY REPLACEMENT The top end cap includes a handle allowing an easy removal of the element and a complete cleaning of the bowl.

### NO LEAKS


The end cap with captive 0-ring ensures a perfect seal between filter element and bowl.

### CLOGGING INDICATOR

For further technical informations and other options see page 184.

**SERIES 30** 

**SERIES P1** 

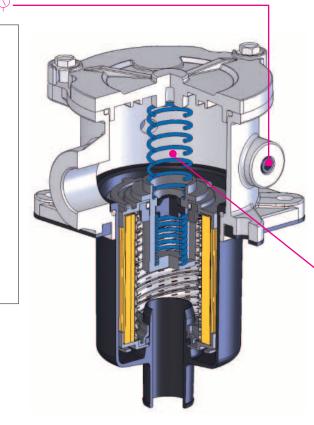

## SPARE SEAL KIT


	NBR	FKM
FRH31	521.0022.2	521.0059.2
FRH32	521.0022.2	521.0059.2
FRH33	521.0022.2	521.0059.2
FRH41	521.0060.2	521.0061.2
FRH42	521.0060.2	521.0061.2

### SPARE SPRING

FRH31	008.0267.1
FRH32	008.0267.1
FRH33	008.0267.1
FRH41	008.0151.1
FRH42	008.0151.1

# SPARE PARTS ELEMENTS

(For filling up see table "Ordering and option chart")

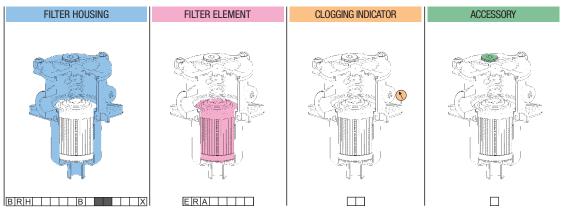

FILLING PLUG



Is this datasheet the latest release? Please check on our website.